

# Landcruiser 200 Series Fitting Issue

## ISSUE

When fitting the **WHEEL CARRIERS** to the LC200 please be aware of the following issue/s:

**Body NOT central on chassis preventing carriers from opening properly**

## IMPORTANT

Each LC200 vehicle may be different

## REMEDY

Once the bumper is removed check to see whether the body is central on the chassis by measuring each side - see two photos below

On this particular vehicle the body has been mounted 8mm off centre to the drivers side.

For the carrier to work correctly and not touch the bumper, cut 4mm (in this example) off the top and bottom stop of the corner bracket - see photo below



Passenger side  
measurement 72mm



Driver side  
measurement 64mm